





3034F

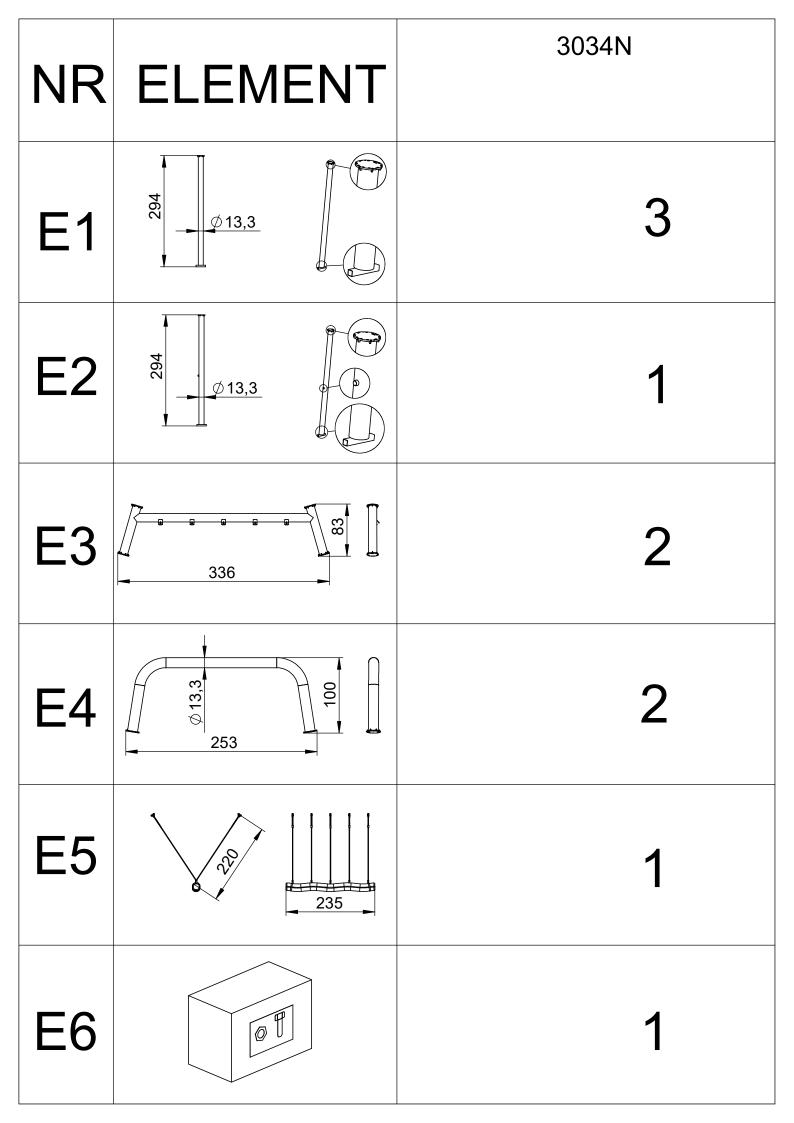


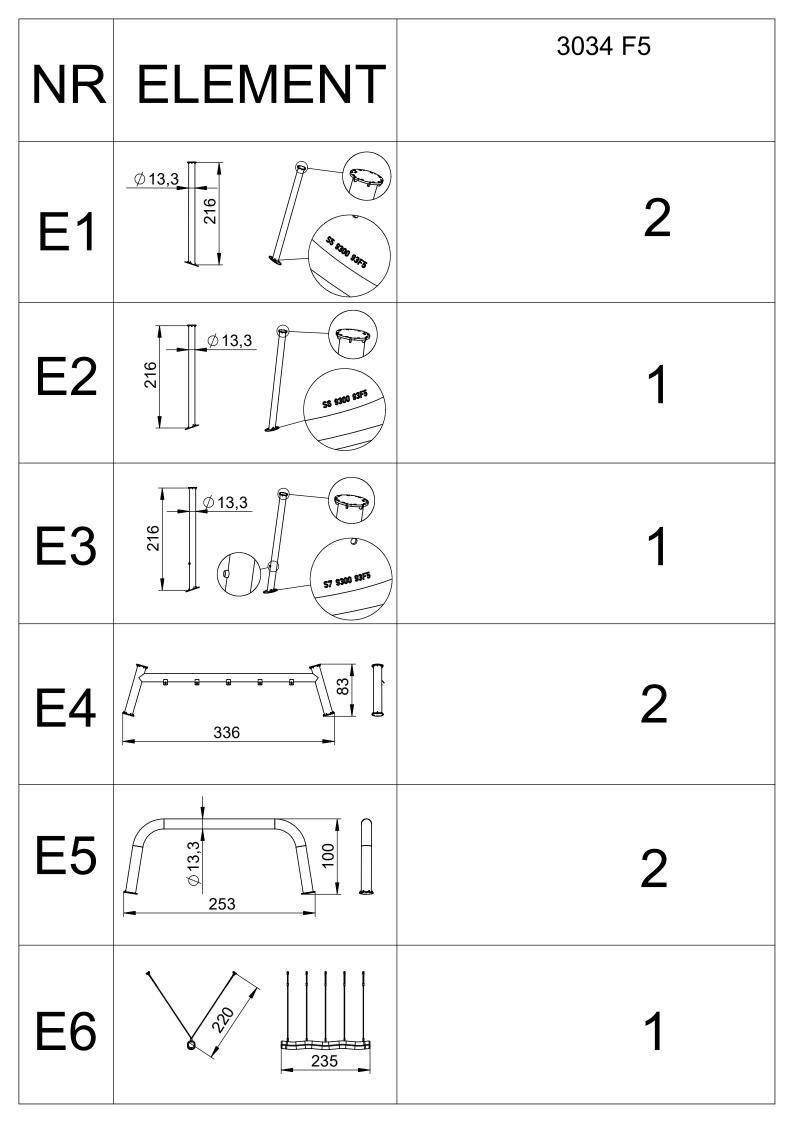


NR	ELEMENT	3034 F5
E7		1

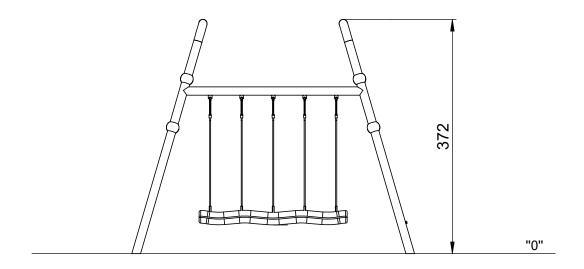


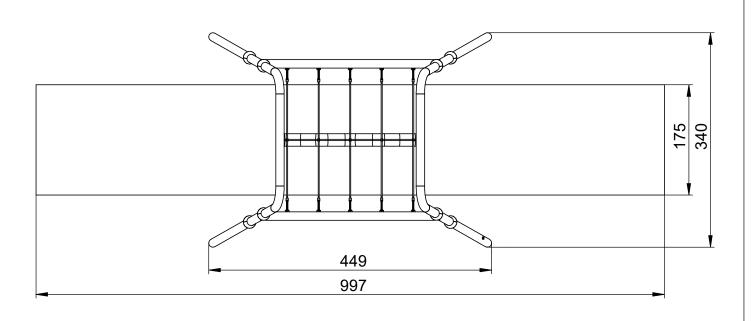


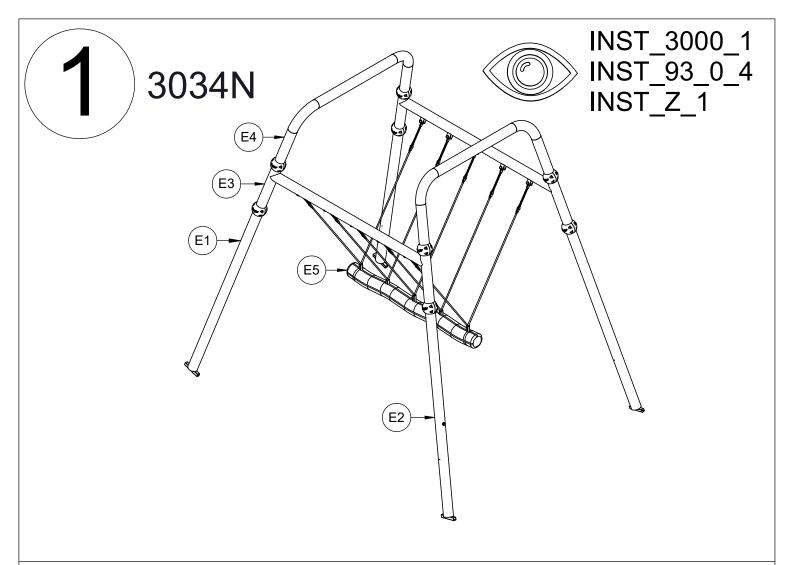

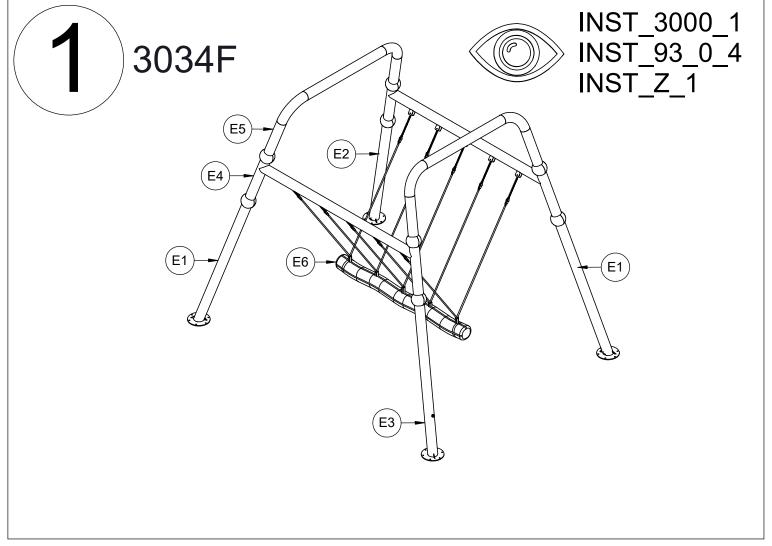

3034N

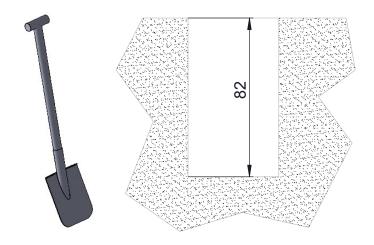


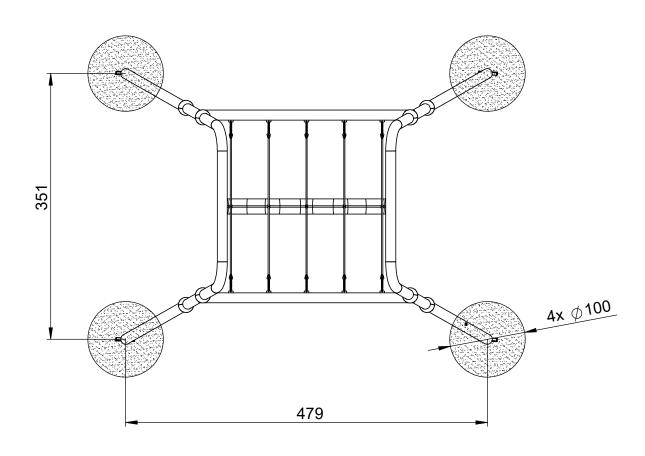


3034N







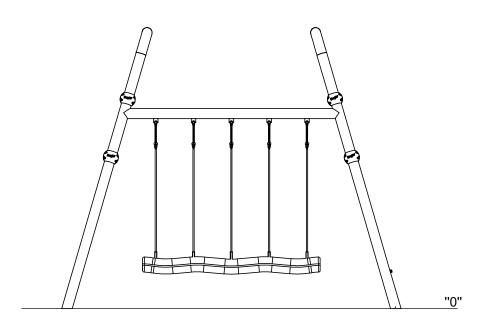


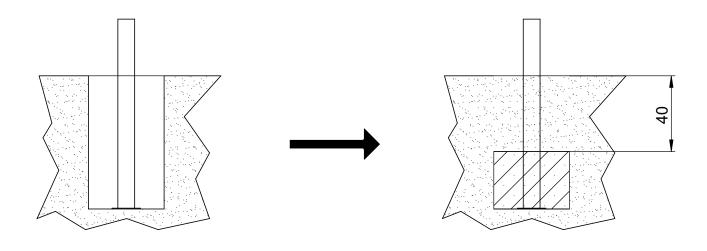



3034F

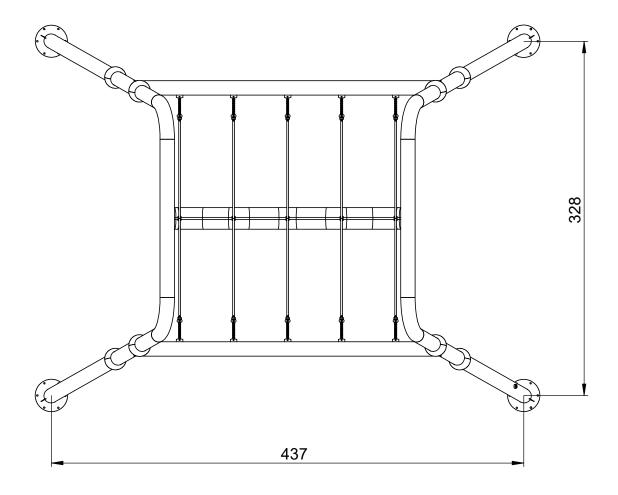

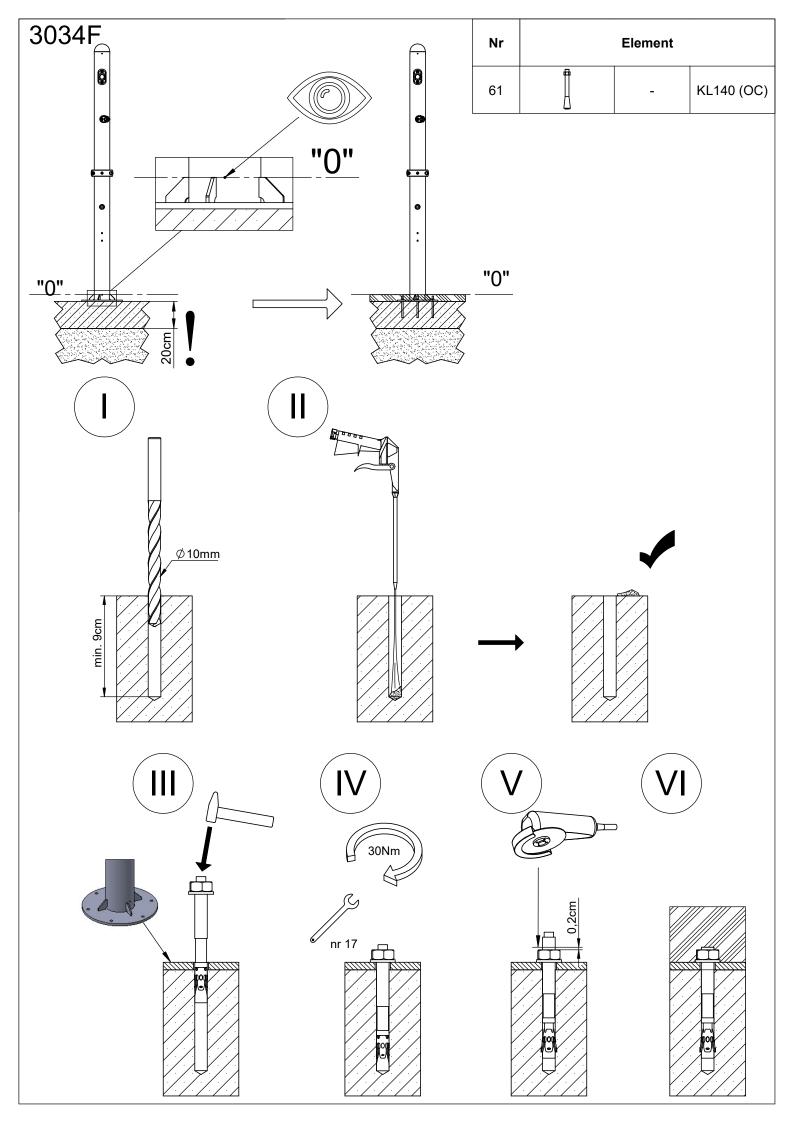


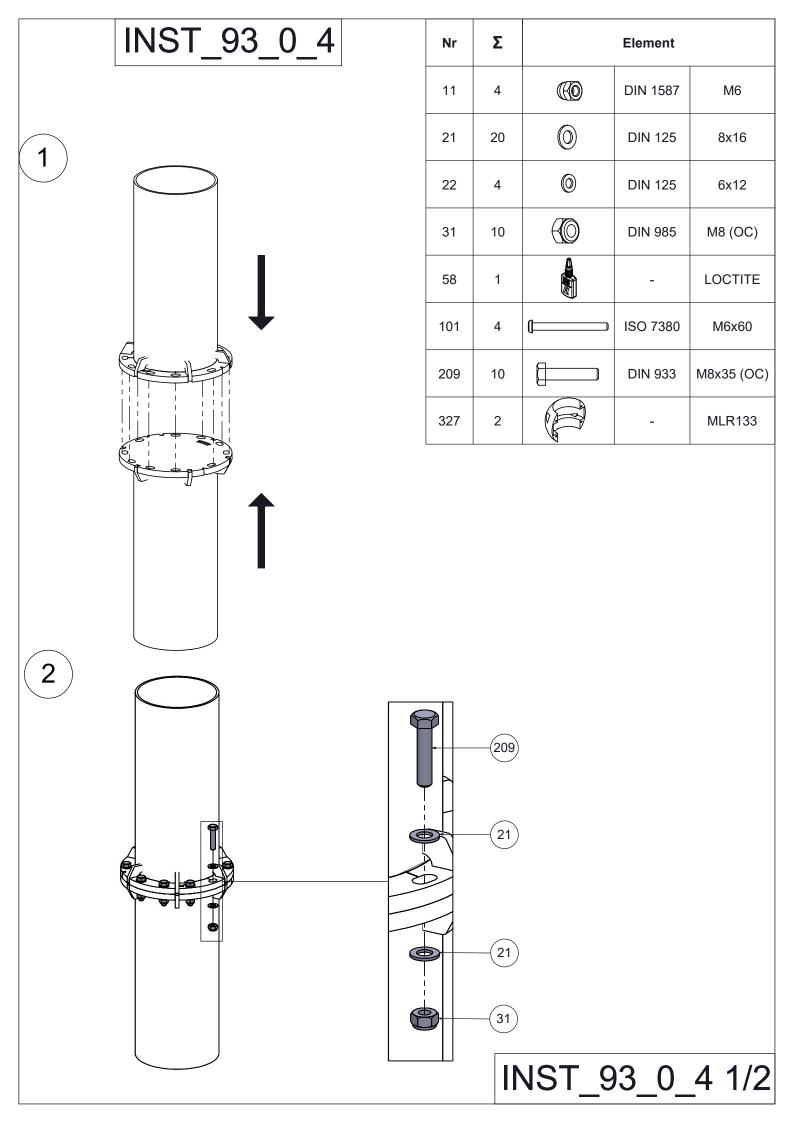


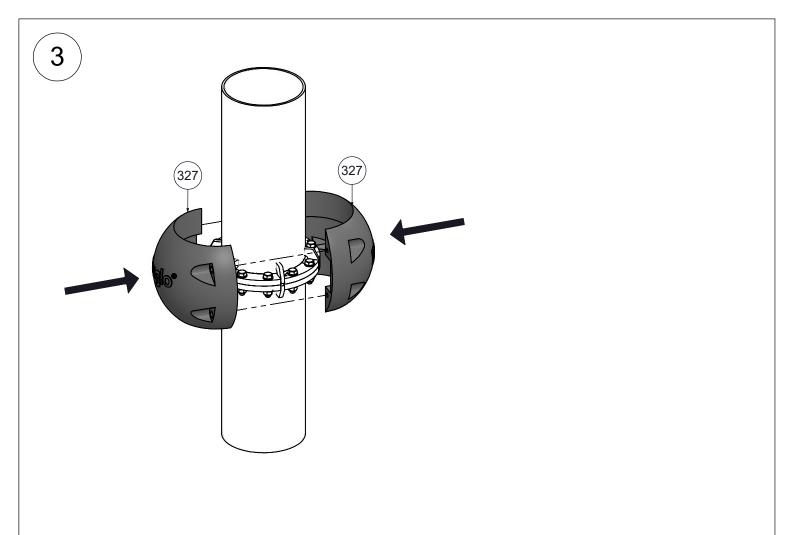

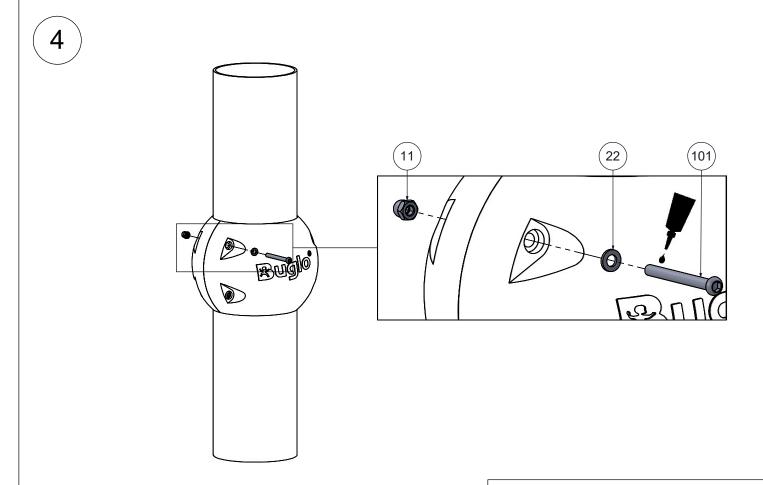



INST_93_0_4 2/2

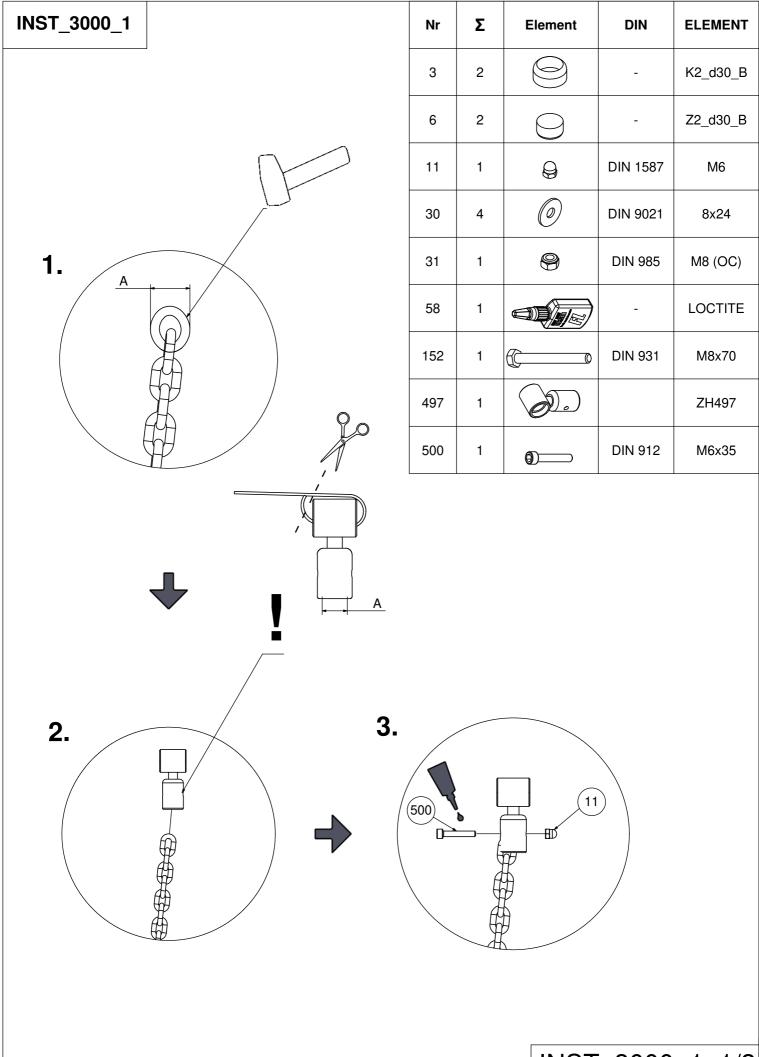

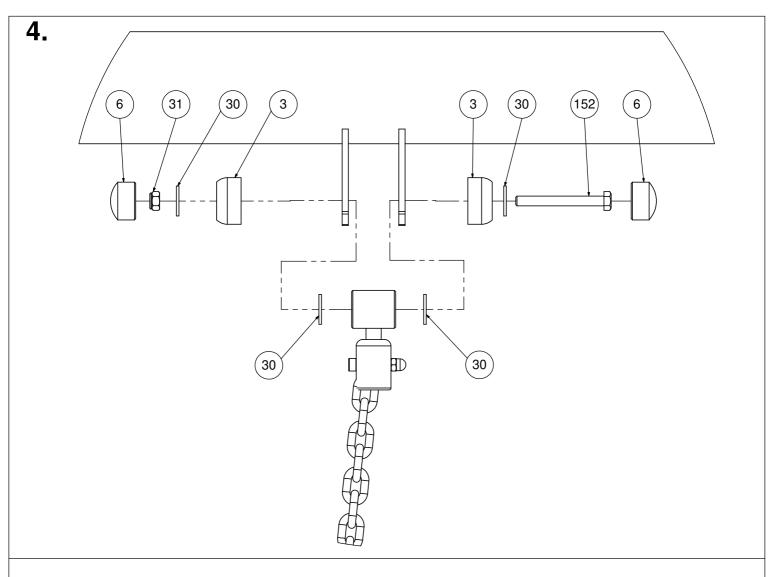



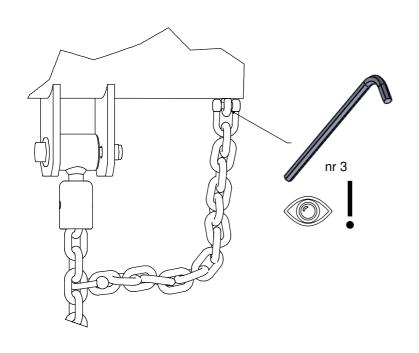

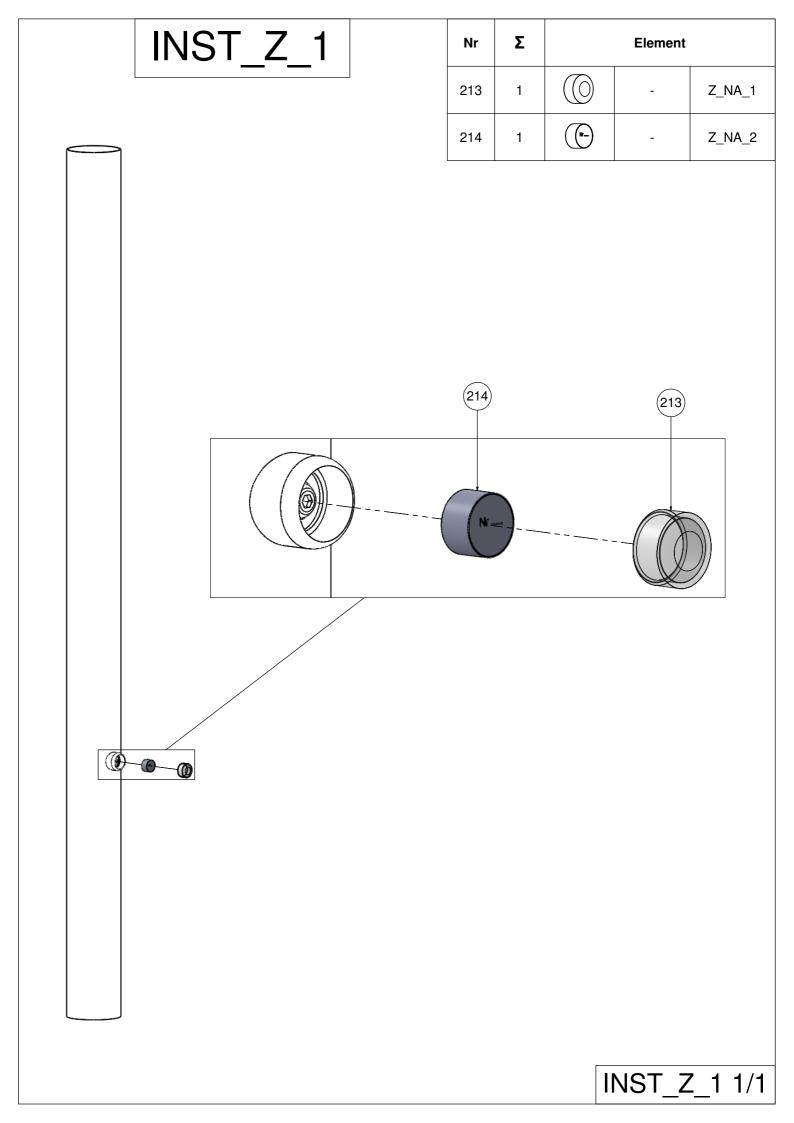

Conservation and control of the Product According to the PN EN 1176-1: 2017-12-Norm

The conservation and exploitation:

It is required to consult with the Manufacturer about all maintaining works of the Products' parts which are under quarantee.

The anticorrosive surface:

Damaged paint coat should be first cleaned out of dust, fat and corrosion centres. After that, the cleaned surface should covered with an anticorrosive primer for steel surfaces. When the layer is dry, paint twice with spray paint.

The colour combination used by BUGLO according to the RAL palette:

Grey - RAL 7035, Yellow - RAL 1003, Blue - RAL 5015, Red - RAL 3000, Green - RAL 6018, Black - RAL 9005, Purple - RAL 4008, Anthracite - RAL 7016, Silver - RAL 9006, Beige - RAL 1019, Orange - RAL 2009, Brown - RAL 8017

Wood:

Elements made of glued laminated timber require a regular renovation. Depending on climate conditions, level of exploitation and mechanical damages, it is advised to renew the impregnation layer after a period of 2-5 years. Before finishing, timber elements need to be mattified, then following products need to be applied:

- 1) Impregnating Foundation GORI 356
- 2) Surface paint NORDICA EKO 3330 12TM1806

Products are available via distribution network of Teknos Company (www.teknos.com). Usage according to the producer's instructions.

IROKO wood: preserve with Owatrol D1.

Stainless steel:

It is recommended to clean stainless steel elements once a year, to remove sediments and contaminats, which accumulation can cause steel discolouring. Wash with cotton cloths and gentle detergent dissolved in water, eg. dishwashing liquid. After cleaning rinse with water and wipe dry.

Caution!

Cleaners used to clean stainless steel **must not** contain: chlorine, salt, acids or bleaches. Even small amount of this substances can cause permanent damage of chromium oxide surface.

Recommendations for the product control according to the EN 1176-7: 2020-Norm Playground equipment and the surfaces part 7: Guidelines for the assembly, control, conservation and exploitation/running.

- 1) <u>Post-installation inspecion</u> recommended before the playgrodun opens for public use to assess the access to the product and its surroundings taking into consideration overall security level.
- 2) <u>The periodic control</u> if the product is used very intensively or is exposed to vandalism, the control should be carried out once a week or more frequently.

The periodic control includes:

- potential damage of any elements,
- tightening of the connectors,
- outer coat of the set,
- condition of the shock-absorbing surface,
- bearing lubrication,
- completeness of the products,
- checking if there are no cracks, sharp edges or other damages,
- the cleanness around the Product (broken glass determines a big danger) and smoothing the safety surface,
- the presence of obstacles in the safe space or fall space and their removal if present,
- general safety status of the playground.
- 3) The functional control should be carried out once every three months.

It includes the range of the periodic inspection enlarged by examining the product's functions.

- during the functional control the fixed elements of the product should be checked (completeness of caps and masking elements),
- checking the stability of the posts,
- checking the loose-fill safety surface (eg. sand, gravel, bark, woodchips) and evening it out. If the level is under 10cm below the marked surface level, it must be filled in,
- tighten all screws,
- checking the tensions of the zip line rope, nets and rope pyramids,
- checking of the condition of welds,
- replacing of worn or damaged elements.

4) The functional control and the main control – mandatory once a year.

The main control covers:

- checking the construction's stability,
- checking and reconstructing the anti-corrosion coating that was damaged,
- checking the foundation's condition,
- checking the loose-fill safety surface (eg. sand, gravel, bark, woodchips) and evening it out. If the level is under 10cm below the marked surface level, it must be filled in,
- checking the condition of wooden elements, if included.

The equipment should have a regular check-up control by competent people (with certified level of competence). Every time the check-up control takes place, the playground administrator should record it on inspetion sheets. Any modifications of the equipment or design that may affect the basic safety of the equipment should be carried out after consultation with the manufacturer or a competent person.

All personnel involved in playground safety management must be competent.

Full range of requirements according to EN 1176-7:2020.

A sample of playground inspection sheet is included in attachment A1.

Control sheet of the playground



	Administrator of the playground							
Controlled equipment (product number, manufacturer number)								
Check-up plan								
1			ften, depends on how intensively the product is used (periodically)	YES	NO			
2	7 1 79							
3								
	'							
5								
6	Are there any obstacles in the	clear spa	ce or fall space?					
Check-up run once in a three months (functional)				YES	NO			
	·	nts comple	te (covers and masking elements are complete)?	-				
	Are the posts stable?		0					
	3 Is the loose safe surface horizontal/even?							
5	4 Is the level of the safety surface up to the marked level or is max. 10cm below this level?							
6	Is the condition of the connect Is the condition of the welds a		ale?					
_	Are the ropes and nets tension	•						
	Replacing of worn or damage		•					
	Check-up run once a year (f	unctiona	an main)	YES	NO			
1 Is the construction stable?								
2	2 Are there any damages to the anticorrosional coat?							
3	3 Is the powdery safe surface horizontal/even?							
4	4 Is the condition of the foundation adequate?							
	5 Is the condition of wooden elements adequate?							
6 Is the level of the safety surface up to the marked level or is max. 10cm below this level?								
Fault/Repair								
1								
2								
3								
4								
5								
			Danta analisara					
	Parts exchange							
_	Name of the part	Qty	Reason					
1								
3								
	Date	Inspecto	r's name					
1								
2								
3								
4								